


TRACT NUMBERS
OWNERSHIP/AGENCY

SURVEY COMPANY: VHB INC.
FIELD BOOK:
PAGES:

EXISTING PIPELINE
PIPELINE MILEPOST
MAINTAINED ROW
CONTOURS
PROPERTY LINE
PARCEL TRACT NUMBER






MAINTAINED ROW

CONTOURS






PROPERTY LINE

PARCEL TRACT NUMBER




- | | |
|---|--------------------|
|  | DRAIN MANHOLE |
|  | CATCH BASIN |
|  | SEWER MANHOLE |
|  | ELECTRIC MANHOLE |
|  | TELEPHONE MANHOLE |
|  | MANHOLE |
|  | HAND HOLE |
|  | WATER GATE |
|  | FIRE HYDRANT |
|  | GAS GATE |
|  | BOLLARD w/LIGHT |
|  | IRRIGATION VALVE |
|  | STREET SIGN |
|  | LIGHT POLE |
|  | UTILITY POLE |
|  | GUY POLE |
|  | GUY WIRE |
|  | COULD NOT OPEN |
|  | NO PIPES VISIBLE |
|  | DOUBLE YELLOW LINE |
|  | DASHED WHITE LINE |

- | | |
|-------|----------------------|
| SYL | SINGLE YELLOW LINE |
| — | EDGE OF PAVEMENT |
| — | GUARD RAIL |
| —○— | CHAIN LINK FENCE |
| — | DRAINAGE LINE |
| — | SEWER LINE |
| — · — | OVERHEAD WIRE |
| — · — | UNDERGROUND ELECTRIC |
| — T — | TELEPHONE LINE |
| — | GAS LINE |
| — | WATER LINE |
| —○— | STONE WALL |
| — | TREE LINE |

- 100-FT BUFFER ZONE
 200-FT RIVER FRONT AREA
 STREAM DELINEATION
 VEGETATED WETLAND BOUNDARY
 EROSION CONTROL
 TEMP. WORK SPACE

- 1) THE PROPERTY LINES SHOWN ON THIS PLAN ARE BASED UPON AN ACTUAL FIELD SURVEY CONDUCTED BY VANASSE HANGEN BRUSTLIN, INC. IN JULY, 2020 AND FROM DEEDS AND PLANS OF RECORD.
- 2) THE EXISTING CONDITIONS SHOWN ON THIS PLAN ARE BASED UPON AN ACTUAL ON-THE-GROUND INSTRUMENT SURVEY PERFORMED BY VANASSE HANGEN BRUSTLIN, INC. IN JULY, 2020.
- 3) THE LOCATIONS OF EXISTING UNDERGROUND UTILITIES SHOWN ON THIS PLAN ARE BASED ON FIELD OBSERVATIONS AND INFORMATION PROVIDED BY THE CLIENT. THEY ARE NOT TO BE EXACTLY LOCATED NOR IS IT WARRANTED THAT ALL UNDERGROUND UTILITIES OR OTHER STRUCTURES ARE SHOWN ON THIS PLAN.
- 4) HORIZONTAL DATUM IS BASED ON MASS. GRID SYSTEM, UTM 19, NAD 88. ELEVATIONS SHOWN ON THIS PLAN REFER TO NAVD 83.
- 5) WETLAND RESOURCE AREAS WERE DELINEATED BY SWCA ENVIRONMENTAL ON SEPTEMBER, 2023.

- 1) TREES AND OTHER WOODY VEGETATION ALONG ACCESS DRIVEWAY WILL BE TRIMMED TO ALLOW FOR SAFE ACCESS OF CONSTRUCTION VEHICLES.
- 2) PROPOSED CONSTRUCTION AND TYPICALS WERE DESIGNED BY OTHERS AND ARE SHOWN FOR GRAPHICAL PURPOSES ONLY.
- 3) CONTRACTOR TO COMPLY WITH ALL APPLICABLE PROVISIONS OF AGT ENVIRONMENTAL CONSTRUCTION EROSION/SEDIMENTATION CONTROL PLAN.
- 4) THE FINAL IMPLEMENTATION AND LOCATION OF EROSION AND SEDIMENT CONTROLS WILL BE DETERMINED BY AN AGT INSPECTOR.

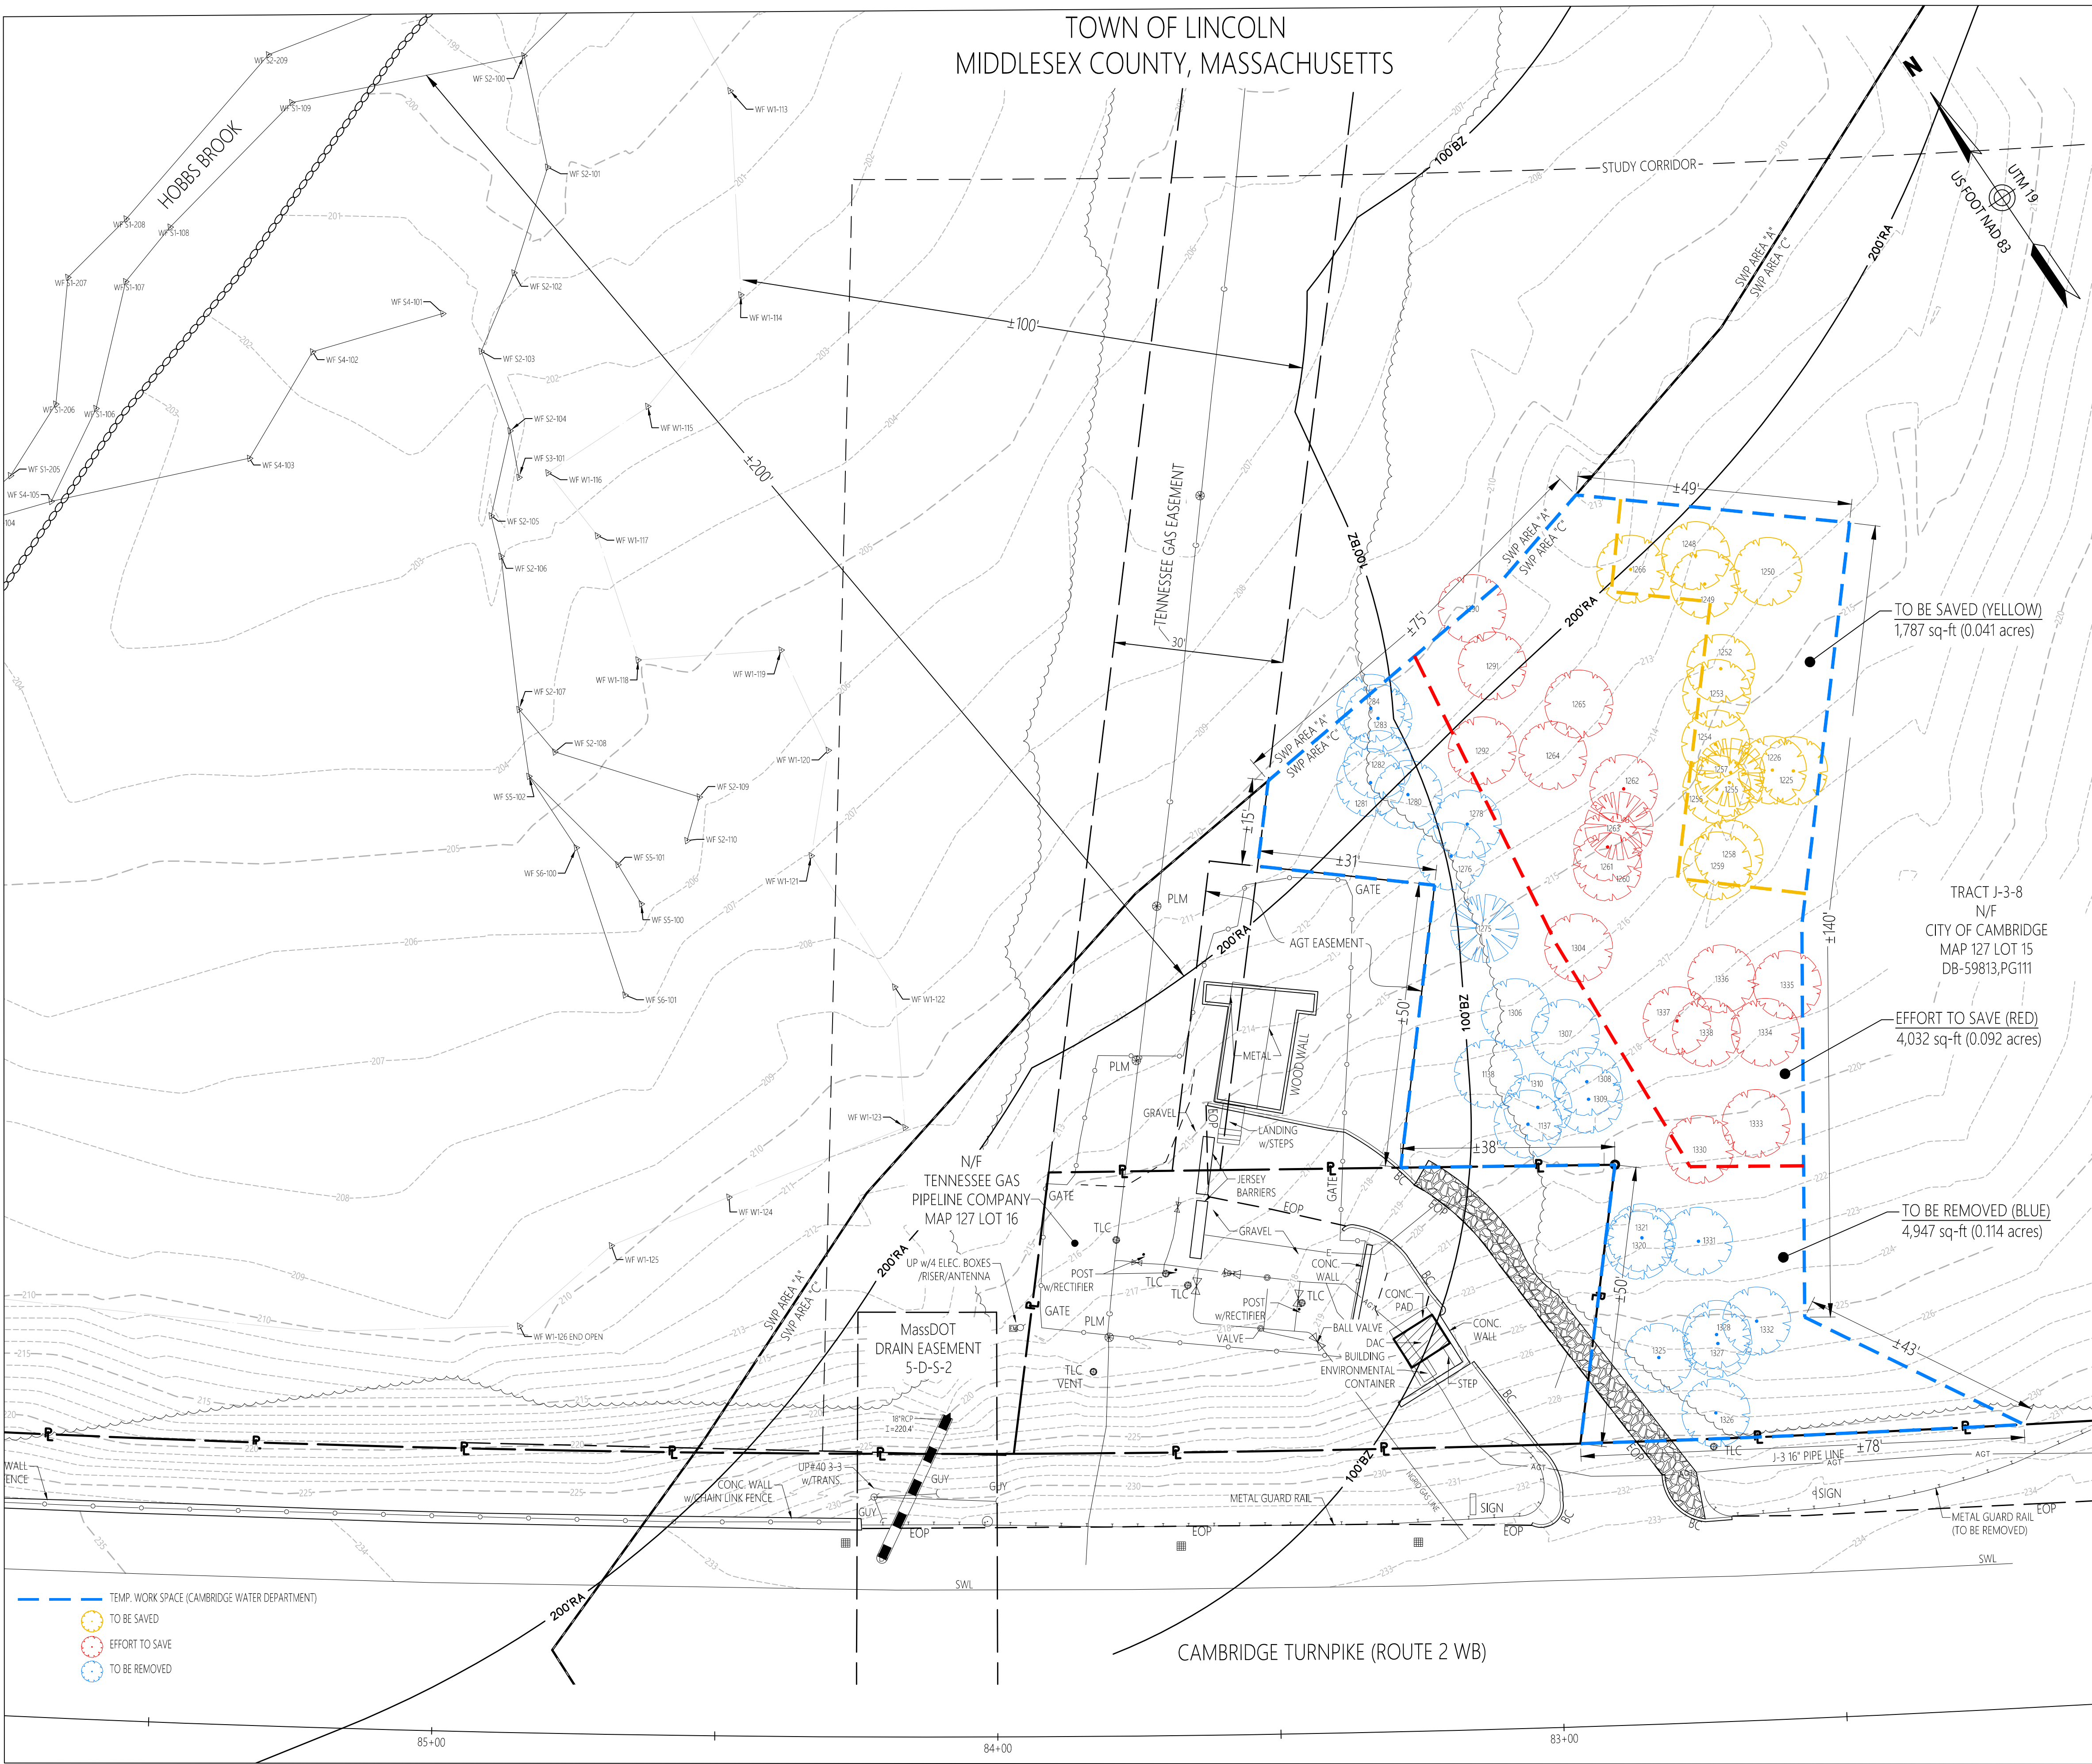

ID #	Species	DBH	Comments
1137	Northern Red Oak (<i>Quercus rubra</i>)	15.1	To be removed (blue)
1138	Black oak (<i>Quercus velutina</i>)	16.6	To be removed (blue)
1275	Red Pine (<i>Pinus resinosa</i>)	20	To be removed (blue)
1276	Black birch (<i>Betula lenta</i>)	14	To be removed (blue)
1278	Red maple (<i>Acer rubrum</i>)	3	To be removed (blue)
1280	Red oak (<i>Quercus rubra</i>)	28	To be removed (blue)
1281	Black birch (<i>Betula lenta</i>)	6	To be removed (blue). Within "Class A" Area
1282	Black birch (<i>Betula lenta</i>)	4	To be removed (blue). Within "Class A" Area
1283	Black birch (<i>Betula lenta</i>)	5	To be removed (blue). Within "Class A" Area
1284	Black birch (<i>Betula lenta</i>)	6	To be removed (blue). Within "Class A" Area
1306	Red maple (<i>Acer rubrum</i>)	8	To be removed (blue)
1307	Red maple (<i>Acer rubrum</i>)	8	To be removed (blue)
1308	Red oak (<i>Quercus rubra</i>)	10	To be removed (blue). Dead topped standing. Peeling bark. High potential roosting habitat.
1309	Red maple (<i>Acer rubrum</i>)	3	To be removed (blue)
1310	Red maple (<i>Acer rubrum</i>)	3	To be removed (blue)
1320	Red maple (<i>Acer rubrum</i>)	3	To be removed (blue)
1321	Red maple (<i>Acer rubrum</i>)	8	To be removed (blue)
1325	Red oak (<i>Quercus rubra</i>)	21	To be removed (blue)
1326	Red oak (<i>Quercus rubra</i>)	28	To be removed (blue). Lightning struck? Long linear scar hollow. High potential roosting
1327	Red maple (<i>Acer rubrum</i>)	6.2	To be removed (blue)
1328	Red maple (<i>Acer rubrum</i>)	4	To be removed (blue)
1331	Black birch (<i>Betula lenta</i>)	13	To be removed (blue)
1332	Red oak (<i>Quercus rubra</i>)	21	To be removed (blue)

1260	Red oak (<i>Quercus rubra</i>)	14	Effort to save (red)
1261	Yellow Birch (<i>Betula alleghaniensis</i>)	6	Effort to save (red). Dead topped lots of peeling bark and wood pecker holes. Moderate potential roosting habitat due to small size.
1262	Black birch (<i>Betula lenta</i>)	6	Effort to save (red)
1263	Red Pine (<i>Pinus resinosa</i>)	18	Effort to save (red)
1264	Red maple (<i>Acer rubrum</i>)	7	Effort to save (red)
1265	Black birch (<i>Betula lenta</i>)	8	Effort to save (red)
1290	Red maple (<i>Acer rubrum</i>)	10	Effort to save (red). Within "Class A" Area
1291	Red maple (<i>Betula lenta</i>)	13	Effort to save (red). Within "Class A" Area
			Many large scars and Hollows from wounds. High potential roosting habitat.
1292	Red oak (<i>Quercus rubra</i>)	12	Effort to save (red)
1304	Black birch (<i>Betula lenta</i>)	5	Effort to save (red). 1 large cavity. Moderate potential roosting habitat.
1330	Red maple (<i>Acer rubrum</i>)	4	Effort to save (red)
1333	Black birch (<i>Betula lenta</i>)	5	Effort to save (red)
1334	Black birch (<i>Betula lenta</i>)	3	Effort to save (red)
1335	Red oak (<i>Quercus rubra</i>)	17	Effort to save (red)
1336	Red oak (<i>Quercus rubra</i>)	22	Effort to save (red)
1337	Red oak (<i>Quercus rubra</i>)	20	Effort to save (red)
1338	Black birch (<i>Betula lenta</i>)	16	Effort to save (red)

1225	Black birch (<i>Betula lenta</i>)	10	To be saved (yellow)
1226	Red oak (<i>Quercus rubra</i>)	12	To be saved (yellow)
1248	Black birch (<i>Betula lenta</i>)	9	To be saved (yellow)
1249	Black birch (<i>Betula lenta</i>)	23	To be saved (yellow)
1250	Black birch (<i>Betula lenta</i>)	3.7	To be saved (yellow)
1252	Black birch (<i>Betula lenta</i>)	4	To be saved (yellow)
1253	Red oak (<i>Quercus rubra</i>)	18	To be saved (yellow)
1254	Black birch (<i>Betula lenta</i>)	8	To be saved (yellow)
1255	Black birch (<i>Betula lenta</i>)	5	To be saved (yellow)
1256	Red oak (<i>Quercus rubra</i>)	15	To be saved (yellow)
1257	White pine (<i>Pinus strobus</i>)	12	To be saved (yellow)
1258	Black birch (<i>Betula lenta</i>)	9	To be saved (yellow)
1259	Red oak (<i>Quercus rubra</i>)	17	To be saved (yellow). Split hollow leaner. Will come down if you take 1263. Long hollow/crack. High potential roosting habitat.
1266	Red maple (<i>Acer rubrum</i>)	3	To be saved (yellow)

[illegible]